

Date: Thursday, 21/08/2008 9:19:07 AM
 User: Julie Lecocq

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	206B AFT X-TUBE
Job Number :	41540		
Estimate Number :	12347		
P.O. Number :		Part Number :	D206667201
This Issue :	21/08/2008	S.O. No. :	
Prsht Rev. :	NC	Drawing Number :	D206-667-241 REVB
First Issue :	21/08/2008	Project Number :	N/A
Previous Run :	41539	Drawing Revision :	B
	Type :	Material :	
	CROSSTUBES	Due Date :	09/09/2008
Written By :		Qty:	1
		Um:	Each
Checked & Approved By :	JLD 08.8.21		
Comment :	Est Rev:F 05.09.01 Add holes for compatibility with Bell Skidtubes KJ/JLM Est Rev:G 08-06-03 update as per DSI9415 (ECN1198) DD verified by:EC		

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	DC	DOCUMENT CONTROL
-----	----	------------------



JLD 08.8.28

**Comment:** DOCUMENT CONTROL

Photocopy bluefile and create labels as per PPP D206-667-201 CHG003

D 08/09/11

2.0	PACKAGING 1	PACKAGING RESOURCE #1
-----	-------------	-----------------------

**Comment:** PACKAGING RESOURCE #1

3.0	D206667201TRN	Crosstube Turning Detail
-----	---------------	--------------------------

**Comment:** Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

CROSSTUBE TURNING DETAIL

batch 640797

D 8-9-2

4.0	BENDING	BENDING MACHINE - SKIDTUBES
-----	---------	-----------------------------

**Comment:** BENDING MACHINE

Bend tube as per Dwg D206-667-241 using CNC bender program 206B-AF and Folio F

D 8-9-2

5.0	QC15	DIMENSIONAL CHECK OF X-TUBES
-----	------	------------------------------

**Comment:** DIMENSIONAL CHECK OF X-TUBES

D 08.09.02

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 21/08/2008 9:19:07 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206B AFT X-TUBE

Job Number: 41540

Part Number: D206667201

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

CROSSTUBES

CROSSTUBES RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes (3/16") as per Dwg D206-667-241 using drill Jig DT8575 & DT8576

2-Drill & ream holes as per Dwg D206-667-241 using drill Jig DT8575 & DT8576.
(DRILL 3 HOLES ON BOTH SIDES)

3-Flip tube and switch drilling Jigs from right to left, left to right. Locate tube using "T" pins off holes drilled in previous step.

4-Drill pilot holes (3/16") as per Dwg D206-667-241 using drill Jig DT8575 & DT8576

5-Drill & ream holes as per Dwg D206-667-241 using drill Jig DT8575 & DT8576. Check dimensions between holes on all four sides to ensure proper alignment. Use DT8583 & 8584 SUPPORT Jigs.
(DRILL 3 HOLES ON BOTH SIDES)

6-Drill rivet holes as per Dwg D206-667-241 using drill Jig DT8788

7-C'sink holes as per Dwg D206-667-241

8-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D206-667-241

9-Scribe part # and batch # using vibrating stylus as per Dwg D206-667-241
Inside of Cuff (Donot engrave on outside of tube)

IT
08-09-03

ANM
8-9-3

7.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



ANM
8-9-3



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

8.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

S 08/09/04 @

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 08/09/04 @

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 21/08/2008 9:19:07 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206B AFT X-TUBE

Job Number: 41540

Part Number: D206667201

Job Number:



Seq. #:

Machine Or Operation:

Description :

10.0

OUTSIDE SERV.10

OUTSIDE SERVICES -skids



Comment: Sub-Contracting OUTSIDE SERVICES

Liquid Penetrant Inspection as per QSI 038Or

Issue P/O: 1097

LPI as per ASTM 1417

Level 2 Attach copy of NDT results to work order

C 208/09/08 ①

11.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Inspect for transit damage

Ensure copy of NDT results attached to work order.

P 208/5 ①

12.0

QC6

DIMENSIONAL CHECK



Comment: Inspect for damage & ensure results are as per Dwg D206-667-103

m 08 09 09 ①

13.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1-Mask Threaded holes

2-Prime inside and outside crosstube as per QSI 005 4.2

3-Paint outside crosstube with White Imron as per QSI 005 4.2

20 08-09 09

14.0

QC14

INSPECT SPRAY PAINT



Comment: Inspect Spray Paint

Wrap in plastic bag to protect from scratches

20 09-10 ①

15.0

D3595075395

RUBBER CUSHION .75" x 3.95



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

RUBBER CUSHION .75" x 3.95

batch: 40220

m 08 09 10

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 21/08/2008 9:19:07 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206B AFT X-TUBE

Job Number: 41540

Part Number: D206667201

Job Number:



Seq. #:

Machine Or Operation:

Description :

16.0

D28911

2.25 Support



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2891-1

Support 35580

ml 08 09 10

17.0

MS2192020

Clamp (per MIL-DTL-8783C)



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part number Description Batch

4 MS21920-20

Clamp 107501

ml 08 09 10

18.0

CROSSTUBES

CROSSTUBES RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

A/R Magnabond 6398

batch: 108966 exp/10/2009
time: 11:00am

ml 08 09 10 ①

1-Install supports and clamps as per Dwg D206-667-241 and DSi9415. Torque clamps to 80-100 in lb

KT 08-09-10

19.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 08/09/11 ②

20.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Pick Packing Kit

21.0

AN532A

Bolt



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Bolt

M107013

SL

22.0

D2872043

Nut Plate Assembly



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch

2 D2872-043

Nut Plate 1228918

819/11

SC

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 21/08/2008 9:19:07 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206B AFT X-TUBE

Job Number: 41540

Part Number: D206667201

Job Number:



Seq. #:

Machine Or Operation:

Description :

23.0

D2872045

Nut Plate Assembly



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number

Description Batch

2 D2872-045

Nut Plate

1328919

SP

24.0

AN510A

Bolt



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Pick: Packing Kit

Qty Part number

Description Batch

10 AN5-10A

Bolt

M108827

SP

25.0

AN530A

BOLT



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Pick: Packing Kit

Qty Part number

Description Batch

10 AN5-30A

Bolt

M105144

SP

26.0

AN960JD516

Washer



Comment: Qty.: 20.0000 Each(s)/Unit Total : 20.0000 Each(s)

Pick: Packing Kit

Qty Part number

Description Batch

20 AN960JD516

Washer

M108672

SP

27.0

MS21042L5

Nut



Comment: Qty.: 10.0000 Each(s)/Unit Total : 10.0000 Each(s)

Pick: Packing Kit

Qty Part number

Description Batch

10 MS21042L5

NUT

M108161

8/9/11

SP

28.0

QC4

INSPECT 100% KITS FOR COMPLETENESS



Comment: INSPECT 100% KITS FOR COMPLETENESS

Soasloely

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 21/08/2008 9:19:07 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: 206B AFT X-TUBE

Job Number: 41540

Part Number: D206667201

Job Number:



Seq. #:

Machine Or Operation:

Description :

29.0

PACKAGING 1

PACKAGING RESOURCE #1



(K)

Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D206-667-201

Location: 62

PPP Rev: C

8/9/11

SP

30.0

QC21

FINAL INSPECTION/W/O RELEASE



08/09/16 (J)

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



MF 08-09-11

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order:	41540
Description: Crosstube High Aft (206B)		Part Number:	D206-667-201
Inspection Dwg: D206-667-241 Rev: B		Page 1 of 1	

Required Dimension	Min	Max
Height	24.98	25.10
1/2 Span	36.54	36.66
Angle	65	67
Total Span	73.08	73.32

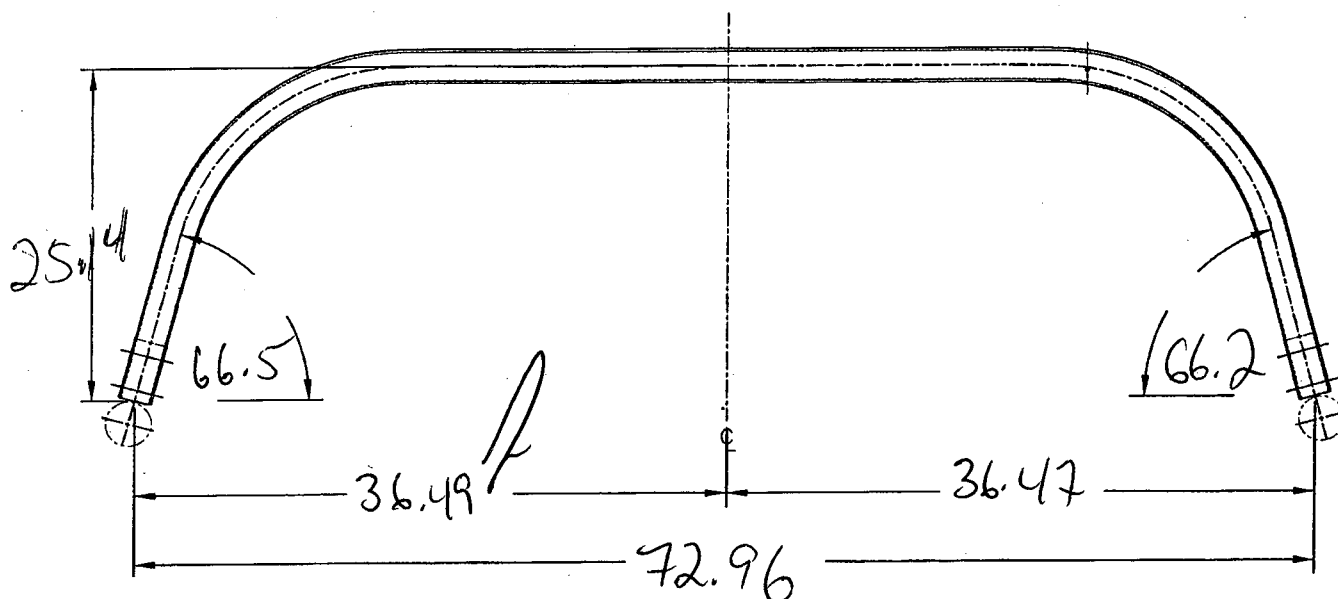

Comments

QC15 Inspection	<i>[Signature]</i>
Date	08/09/02

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	<i>[Signature]</i>
B	07.12.04	24-98 was 24.48	KJ/JM <i>[Signature]</i>	<i>[Signature]</i>



DESIGN PH	DRAWN BY PH	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED [Signature]	APPROVED [Signature]	DRAWING NO. D206-667-241	REV. B SHEET 1 OF 3
DATE 05.02.04		TITLE CROSSTUBE ASS'Y (206B HIGH AFT)	SCALE NTS
A	00.11.17	NEW ISSUE	
B	05.02.04	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	

RELEASED
05.06.16 [Signature]

Qty	Part Number	Description
X	D206-667-241	CROSSTUBE ASSEMBLY (206B HIGH AFT)
1	D6003-102	CROSSTUBE
2	D2856-400-694	ABRASION STRIP
2	D2891-1	SUPPORT
4	MS21920-20	CLAMP



GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED
- 2) MATERIAL: MANUFACTURED FROM D6003-102
FINISHED LENGTH = 100.60±0.020
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 4) PART IS SYMMETRIC ABOUT CENTERLINE
- 5) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALY, TRANSITION SHOULD BE SMOOTH.
- 6) BEND PROGRESSIVELY WITH A MINIMUM OF 12 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 7) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 8) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 9) INSTALL D2856-400-694 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF CROSSTUBE, CENTERED OPPOSITE D2891-1 SUPPORT, PER QSI 035.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 11) IT IS OPTIONAL TO SEAL EDGES OF SUPPORTS AND ABRASION STRIP USING 241/291 SEALANT.
- 12) TORQUE CLAMPS 80 TO 100 IN-LB.

STOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 41540

Copyright © 2000 by DART AEROSPACE LTD




THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

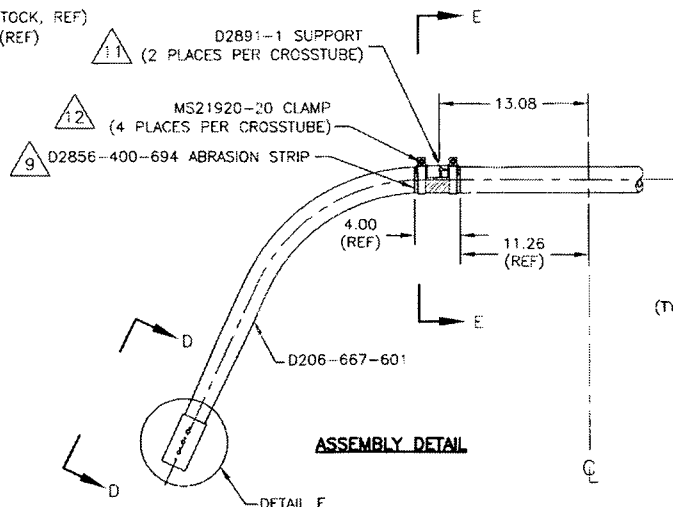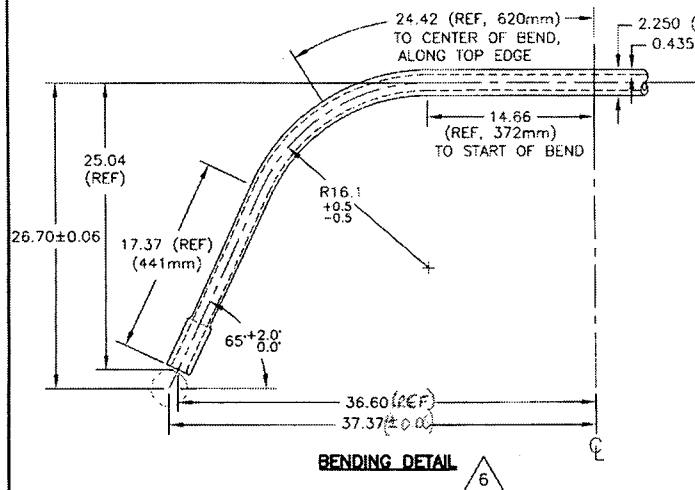

DETAIL B
 $\varnothing 0.323^{+0.005}_{-0.000}$
 HOLE TO BE ALIGNED WITHIN ± 0.001 OF HOLE ON OTHER SIDE OF CUFF (TYP 6 PLACES PER CUFF)

DETAIL C
 $\varnothing 0.128$
 $\varnothing 0.225 \times 100'$
 (TYP 8 PLACES PER CUFF)

DETAIL F
 SCALE 2:5

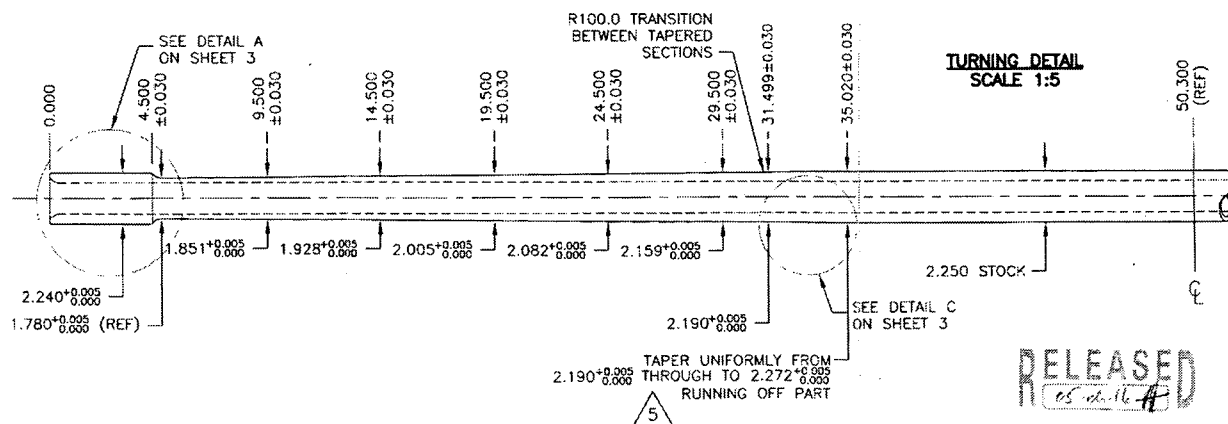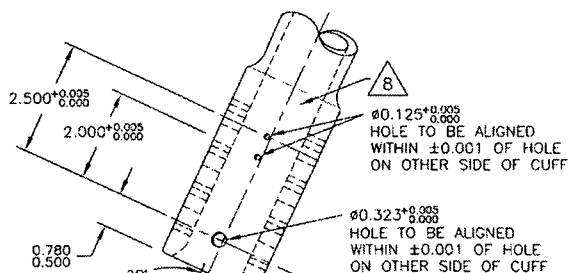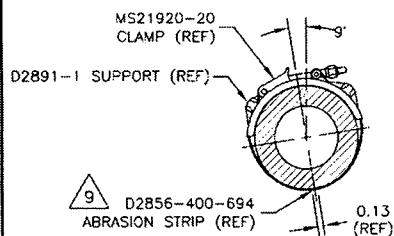

RELEASED
 05.02.04

COPYRIGHT © 2000 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN
 CHECKED
 DATE
 05.02.04


DRAWN BY
 APPROVED
 DRAWING NO.
 D206-667-241

DART DART AEROSPACE LTD.
 HARRISBURG, ONTARIO, CANADA
 REV. B
 SHEET 2 OF 3
 SCALE
 CROSSTUBE ASS'Y (206B HIGH AFT) 1:10


NO. 475420
 WORK ORDER
 WITHOUT NOTICE
 SUBJECT TO AMENDMENT
 SHIP COPY
 INTO
 ORDERING
 LLED COPY
 ORDERING
 ORDERING

RELEASED
05-06-16-7


DETAIL A: CROSSTUBE CUFF

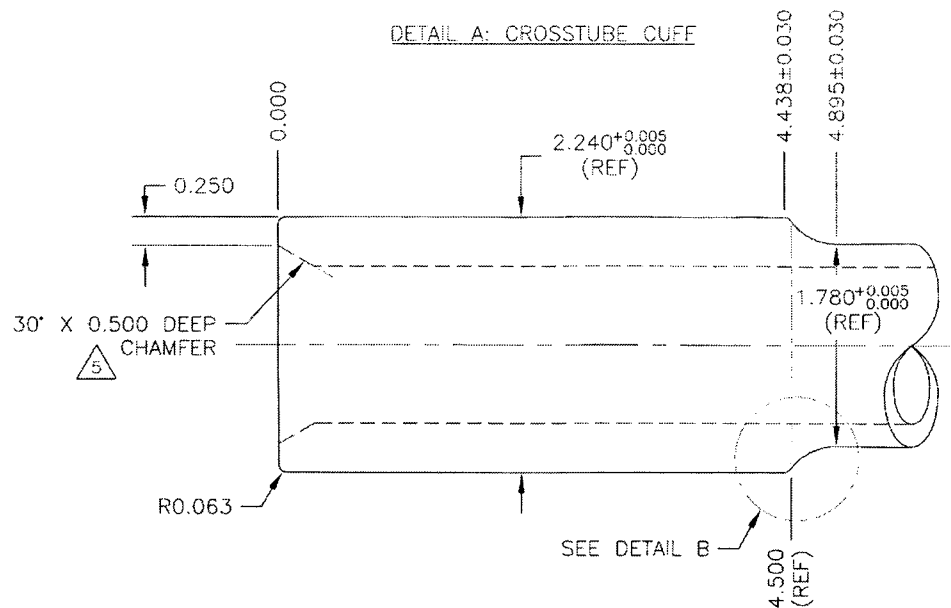

DETAIL B: CUFF
TRANSITION
SCALE 4:1

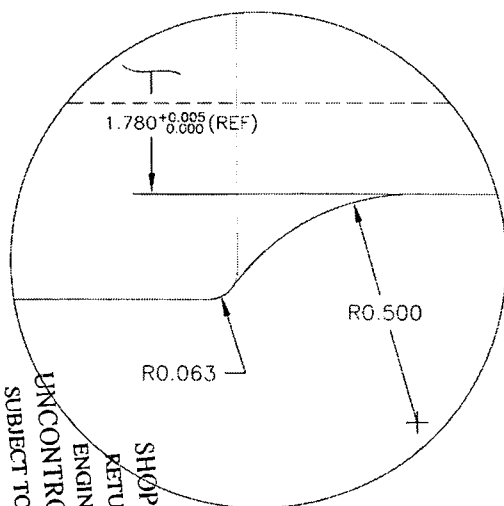

DETAIL C:
TAPER RUN-OFF
NOT TO SCALE

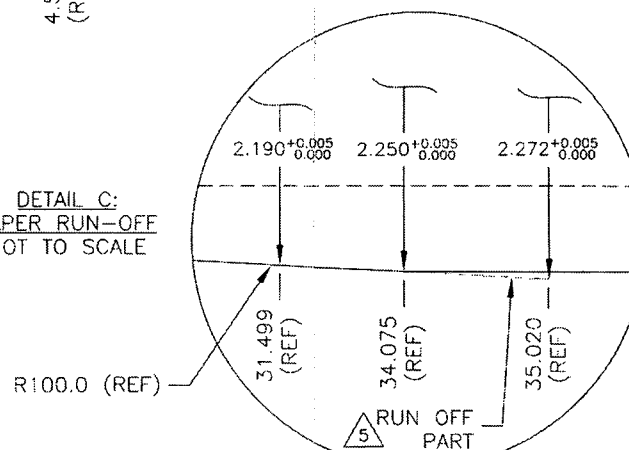

COPYRIGHT © 2000 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN	PH	DRAWN BY	PH	DART	DART AEROSPACE LTD. WARRICKBURT, GUYANA, GANADA
CHECKED	#	APPROVED	#	DRAWING NO.	REV. 8
DATE	05.02.04	TITLE	CROSSTUBE ASS'Y (206B HIGH AFT)	D206-667-241	SHEET 3 OF 3
		SCALE	1:1		

NO. 443220
WORK ORDER
WITHOUT NOTICE
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY



LIQUID PENETRANT TEST REPORT

P - 1464 1

CLIENT	DART AEROSPACE	DATE	SEP 5, 2008	PAGE	1	OF	1
ATTENTION	LINDA LACELLE	ACUREN JOB NO.	188 08 1464	TIME	AM <input type="checkbox"/>	PM <input type="checkbox"/>	
ADDRESS	1270 ABERDEEN ST	POW/NO.	7097				
	HAWKESBURY, ONT.	WORK LOCATION	HAWKESBURY, ONT.				
		ACCEPTANCE STD.	ASTM 1417/QSI-038	REV./DATE	2005		
PROJECT	206L FWD X TUBE, 206B AFT X TUBE, 212/205 HIGH FED X TUBES, 407 FWD X TUBE						
ITEM(S) EXAMINED	JOB #S: 41395, 41396, 41403, 41404, 41539, 41540, 40786, 40787, 41405, 41406						

JOB DESCRIPTION	PROCEDURE NO. LT-0002	REV./DATE	TECHNIQUE NO. LT-TECH2	REV./DATE
'PART NO. D206667103/D206667202/D212664101/D407667105	MATERIAL	ALODINED ALUM.	THICKNESS	
SCOPE	WET FLOURESCENT LIQUID PENETRANT INSPECTION CARRIED OUT ON 100% EXTERNAL SURFACE			

TEST DETAILS

METHOD	<input checked="" type="checkbox"/> FLUORESCENT	<input type="checkbox"/> VISIBLE	<input checked="" type="checkbox"/> WATER WASH	<input type="checkbox"/> SOLVENT REMOVABLE	<input type="checkbox"/> POST EMULSIFIED
FAMILY BRAND	MAGNAFLUX		BLACK LGHT8171	<input type="checkbox"/> OUTPUT > 1000 μ W/cm ²	<input type="checkbox"/> AMBIENT < 2 fc
PENETRANTZL67	MINIMUM DWELL TIME	45 MIN.	LIGHTING EQUIP.	<input type="checkbox"/> FLASHLIGHT	<input type="checkbox"/> TROUBLELIGHT
PENETRANT REMOVER H2O	MINIMUM DRY TIME	>10 MIN.	OTHER	CAL JUNE 16 08	
DEVELOPER SKDS2	MINIMUM DWELL TIME	10 MIN.	LIGHT METER S/N	CAL DUE DATE	
DEVELOPER TYPE	<input checked="" type="checkbox"/> NON AQUEOUS	<input type="checkbox"/> AQUEOUS	<input type="checkbox"/> DRY		

TEST SURFACE

SURFACE CONDITION	<input type="checkbox"/> AS GROUND	<input type="checkbox"/> AS WELDED	<input type="checkbox"/> MACHINED	<input type="checkbox"/> SHOT BLASTED	<input checked="" type="checkbox"/> CLEAN BARE METAL
SURFACE TEMPERATURE	<input type="checkbox"/> < - 4°C/ 20°F	<input type="checkbox"/> - 4°C/ 20°F TO 10°C/50°F	<input type="checkbox"/> 10°C/50°F TO 52°C/125°F	<input type="checkbox"/> > 52°C/125°F	

RESULTS- (☐ METRIC ☒ IMPERIAL)

FLUORESCENT LIQUID PENETRANT INSPECTION
CARRIED OUT ON 100% EXTERNAL
SURFACE ON:

206B AFT X TUBE JOB#S: 41539, 41540
212/205 HIGH FED X TUBES JOB#: 40786, 40787.
407 FWD X TUBES JOB#S: 41405, 41406.
206L FWD X TUBE JOB#S: 41395, 41396, 41403, 41404.

RESULTS: NO INDICATION OF DEFECTS.
ITEMS ACCEPTABLE TO STANDARD

Scope of Services

The agreement of Acuren Group Inc. to perform services extends only to those services provided for in writing. Under no circumstances shall such services extend beyond the performance of the requested services. It is expressly understood that all descriptions, comments and expressions of opinion reflect the opinions or observations of Acuren Group Inc. based on information and assumptions supplied by the owner/operator and are not intended nor can they be construed as representations or warranties. Acuren Group Inc. is not assuming any responsibilities of the owner/operator and the owner/operator retains complete responsibility for the engineering, manufacture, repair and use decisions as a result of the data or other information provided by Acuren Group Inc. In no event shall Acuren Group Inc.'s liability in respect of the services referred to herein exceed the amount paid for such services.

Standard of Care

In performing the services provided, Acuren Group Inc. uses the degree, care and skill ordinarily exercised under similar circumstances by others performing such services in the same or similar locality. No other warranty, expressed or implied, is made or intended by Acuren Group Inc.

SIGNATURES

CLIENT REPRESENTATIVE	DTR # E 19943	
TECHNICIAN (SIGNATURE):	REPORT REVIEWED BY:	
NAME (PRINT):	NAME	INITIALS
JASON HEWETT		
1 ST TECHNICIAN	2 ND TECHNICIAN	
CGSB LEVEL 2 SNT LEVEL	CGSB LEVEL SNT LEVEL	
CGSB REG. NO 6156	CGSB REG. NO	

WHITE - CLIENT COPY

CANARY - OFFICE COPY

PINK - TECHNICIAN COPY

GOLD - OFFICE COPY